


호남고속선 정지고가 _977(63.704~63.711km, S186-3)

63K704

63K711
186 SPAN - 3

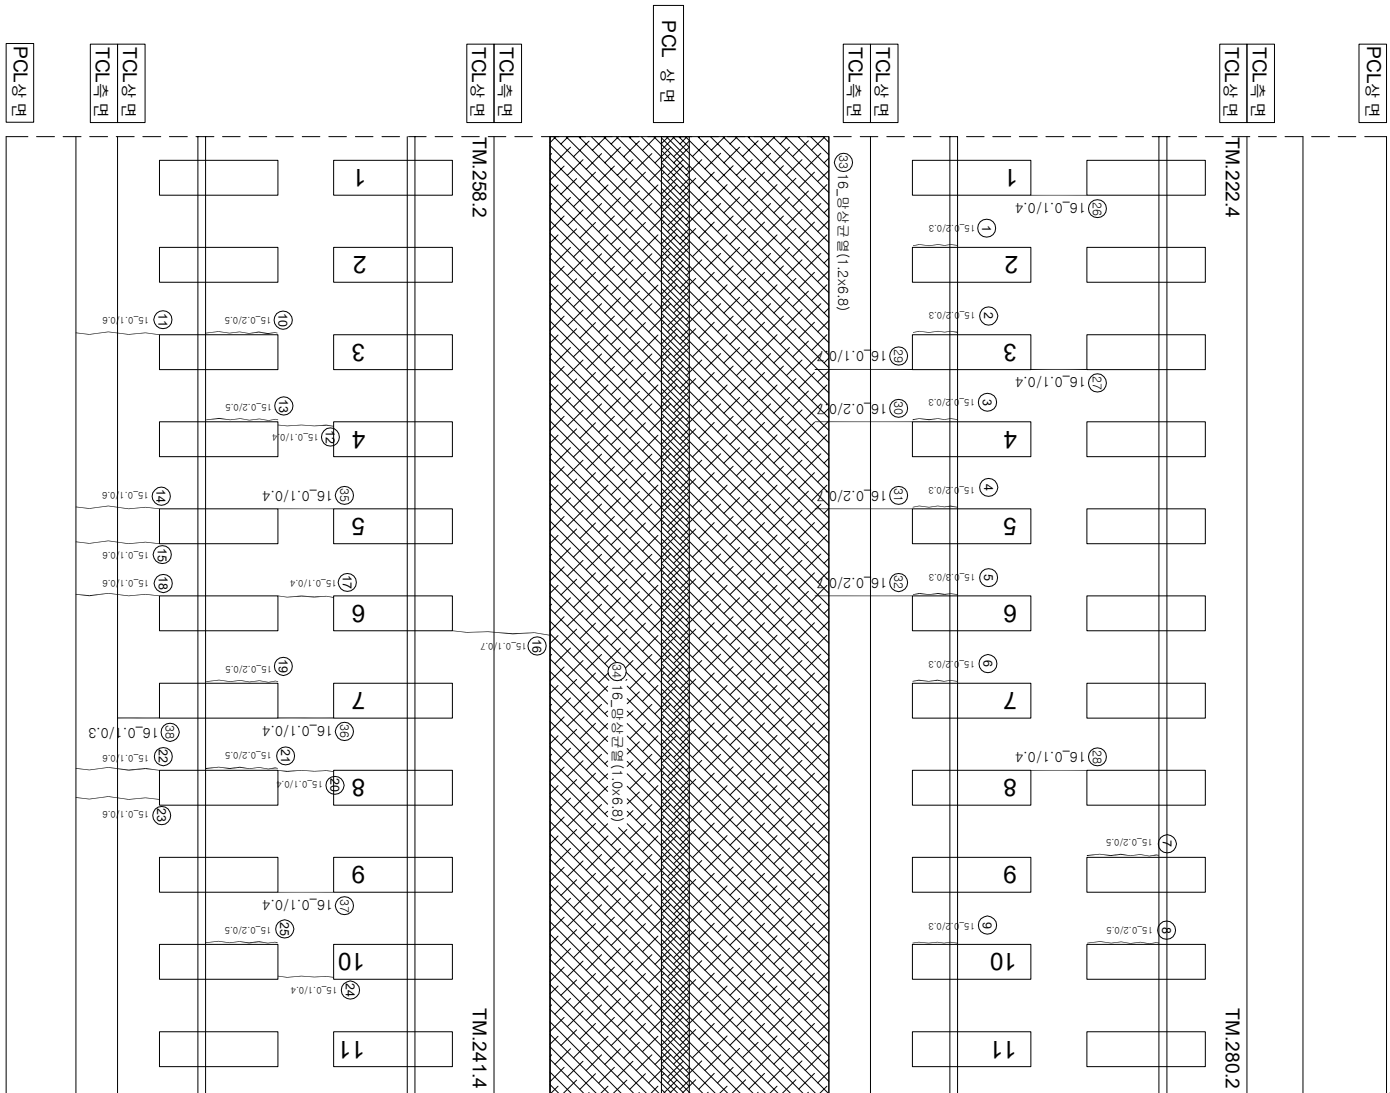

연번	순번	목	연장	비고	연번	순번	목	연장	비고
1	강제부 균열	0.2 mm	0.3 m		55				
2	강제부 균열	0.2 mm	0.3 m		56				
3	강제부 균열	0.2 mm	0.3 m		57				
4	강제부 균열	0.2 mm	0.3 m		58				
5	강제부 균열	0.3 mm	0.3 m		59				
6	강제부 균열	0.2 mm	0.3 m		60				
7	강제부 균열	0.2 mm	0.5 m		61				
8	강제부 균열	0.2 mm	0.5 m		62				
9	강제부 균열	0.2 mm	0.3 m		63				
10	강제부 균열	0.2 mm	0.5 m		64				
11	균열	0.1 mm	0.6 m		65				
12	균열	0.1 mm	0.4 m		66				
13	강제부 균열	0.2 mm	0.5 m		67				
14	균열	0.1 mm	0.6 m		68				
15	균열	0.1 mm	0.6 m		69				
16	균열	0.1 mm	0.7 m		70				
17	균열	0.1 mm	0.4 m		71				
18	균열	0.1 mm	0.6 m		72				
19	강제부 균열	0.2 mm	0.5 m		73				
20	균열	0.1 mm	0.4 m		74				
21	강제부 균열	0.2 mm	0.5 m		75				
22	균열	0.1 mm	0.6 m		76				
23	균열	0.1 mm	0.6 m		77				
24	균열	0.1 mm	0.4 m		78				
25	강제부 균열	0.2 mm	0.5 m		79				
26	균열	0.1 mm	0.4 m		80				
27	균열	0.1 mm	0.4 m		81				
28	균열	0.1 mm	0.4 m		82				
29	균열	0.1 mm	0.7 m		83				
30	균열	0.2 mm	0.7 m		84				
31	균열	0.2 mm	0.7 m		85				
32	균열	0.2 mm	0.7 m		86				
33	방산균열	1.2 m	6.8 m		87				
34	방산균열	1.0 m	6.8 m		88				
35	균열	0.1 mm	0.4 m		89				
36	균열	0.1 mm	0.4 m		90				
37	균열	0.1 mm	0.4 m		91				
38	균열	0.1 mm	0.3 m		92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시행	사명	종목	여역	장소	구분	구분		
						개최일	제출지	
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주순정간 콘크리트케도 점검용역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이복영	간윤경 김경기 문석기	점검	 0.22% (0.5mm이하 : 흑색)	 참모대상본리
							 0.42% (0.5mm초과 0.5mm이하 : 청색)	 망상
							 0.62% (0.5mm초과 1.0mm이하 : 적색)	 바리,바락,파손
							 1.02% (1.0mm이상 : 분홍색)	 변태
							 0.00%	 시공이음본리,총본리
							 차로본리	
							 누수,습윤부	
							철타노출	
							시공이음본리,총본리	