


호남고속선 정지고가_803(62.516~62.523km S152-2)

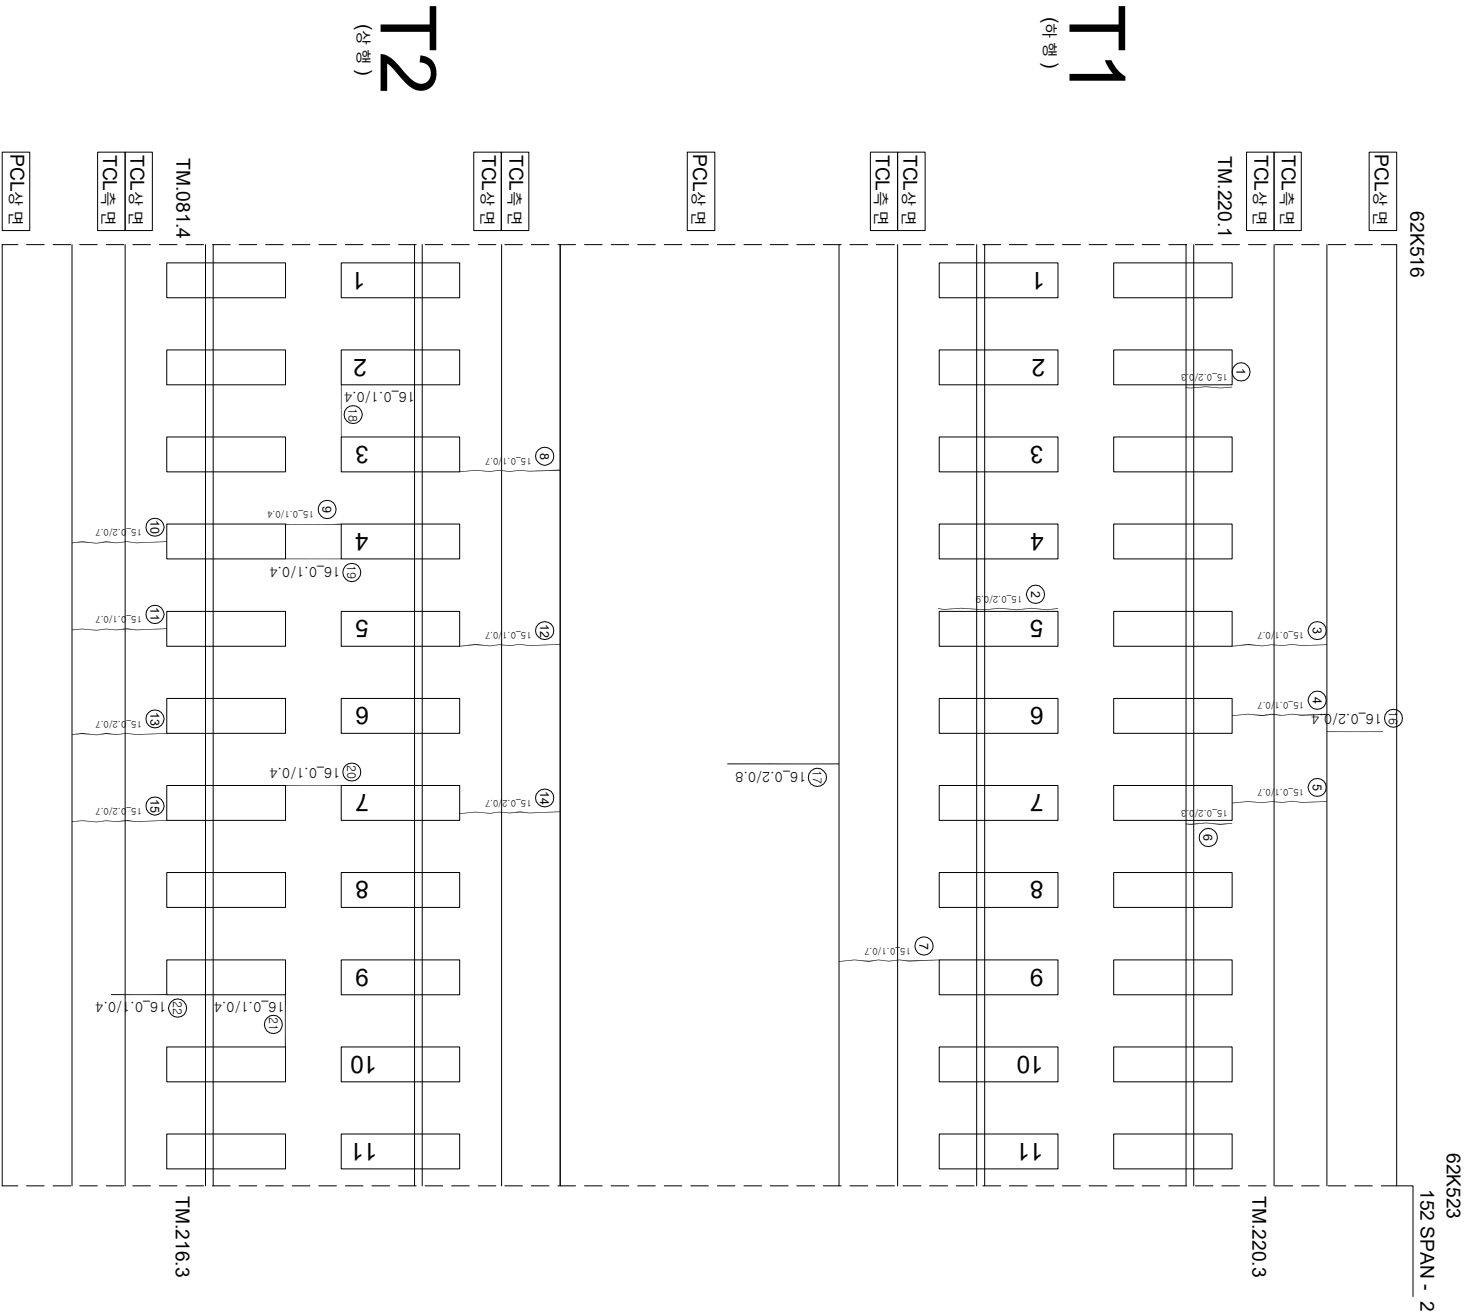

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	강제부 균열	0.2 mm	0.3 m		55				
2	강제부 균열	0.2 mm	0.9 m		56				
3	균열	0.1 mm	0.7 m		57				
4	균열	0.1 mm	0.7 m		58				
5	균열	0.1 mm	0.7 m		59				
6	강제부 균열	0.2 mm	0.3 m		60				
7	균열	0.1 mm	0.7 m		61				
8	균열	0.1 mm	0.7 m		62				
9	균열	0.1 mm	0.4 m		63				
10	균열	0.2 mm	0.7 m		64				
11	균열	0.1 mm	0.7 m		65				
12	균열	0.1 mm	0.7 m		66				
13	균열	0.2 mm	0.7 m		67				
14	균열	0.2 mm	0.7 m		68				
15	균열	0.2 mm	0.7 m		69				
16	균열	0.2 mm	0.4 m		70				
17	균열	0.2 mm	0.8 m		71				
18	균열	0.1 mm	0.4 m		72				
19	균열	0.1 mm	0.4 m		73				
20	균열	0.1 mm	0.4 m		74				
21	균열	0.1 mm	0.4 m		75				
22	균열	0.1 mm	0.4 m		76				
23					77				
24					78				
25					79				
26					80				
27					81				
28					82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

 한국철도공사 KOREA RAILROAD	시행처	영역명	(주) 한국구조물안전연구원 (주)한국의료안전연구원 (재)한국건설품질연구원	이북영	간오강 길경기 문서기	영역		
	계량법	정밀측량법	관아설비법					
		0.220 (0.3mm이하 : 흑색)		천목도장본리			차로본리	
			0.420 (0.3mm초과 0.5mm이하 : 청색)		망상			철근노출
			0.620 (0.5mm초과 1.0mm미만 : 적색)		바리·벽막, 파손			누수·습윤부
		1.020 (1.0mm이상 : 분홍색)		변태		사공어음본리, 총본리		