


화남고속선 정지고가 - 토공노반 - 11(66.320~66.330km, L=10m)

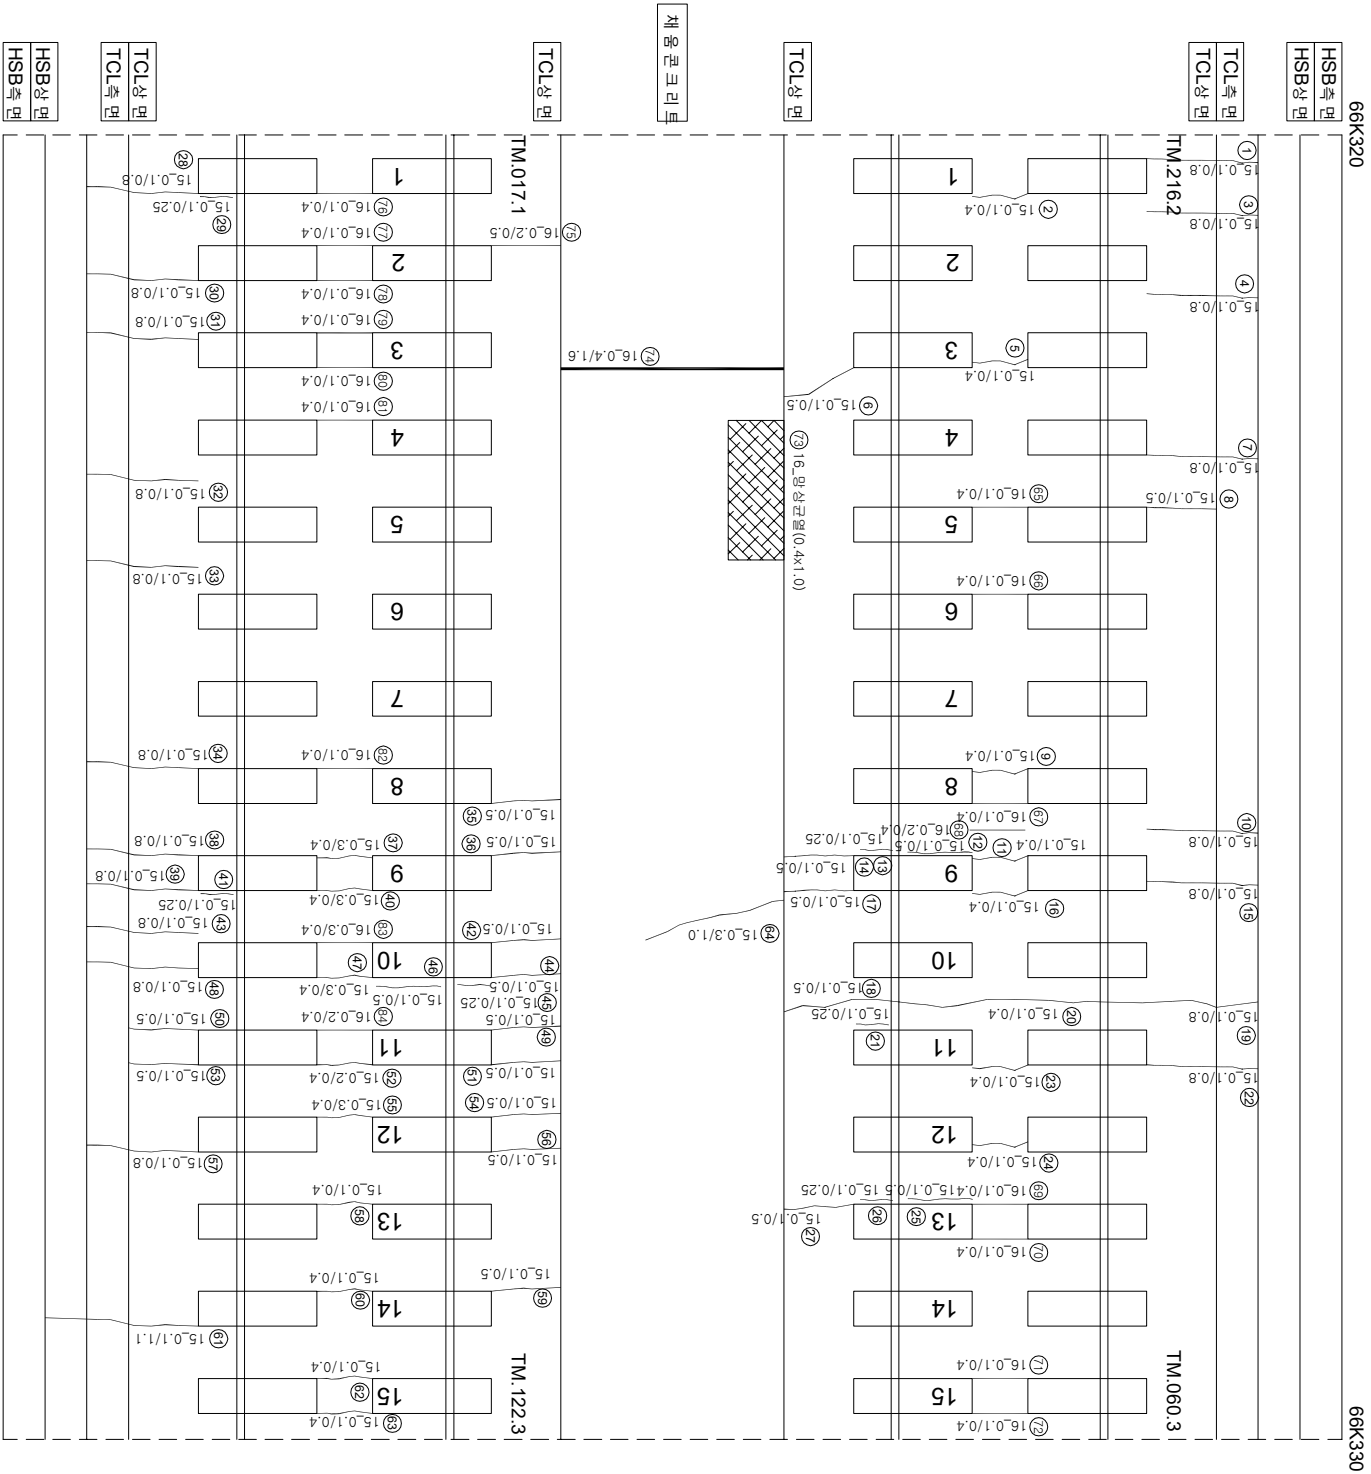

연번	순차	복	연장	비고	연번	순차	복	연장	비고
1	균열	0.1 mm	0.8 m		55	균열	0.3 mm	0.4 m	
2	균열	0.1 mm	0.4 m		56	균열	0.1 mm	0.5 m	
3	균열	0.1 mm	0.8 m		57	균열	0.1 mm	0.8 m	
4	균열	0.1 mm	0.8 m		58	균열	0.1 mm	0.4 m	
5	균열	0.1 mm	0.4 m		59	균열	0.1 mm	0.5 m	
6	균열	0.1 mm	0.5 m		60	균열	0.1 mm	0.4 m	
7	균열	0.1 mm	0.8 m		61	균열	0.1 mm	1.1 m	
8	균열	0.1 mm	0.5 m		62	균열	0.1 mm	0.4 m	
9	균열	0.1 mm	0.4 m		63	균열	0.1 mm	0.4 m	
10	균열	0.1 mm	0.8 m		64	균열	0.3 mm	1 m	
11	균열	0.1 mm	0.4 m		65	균열	0.1 mm	0.4 m	
12	균열부 균열	0.1 mm	0.5 m		66	균열	0.1 mm	0.4 m	
13	균열부 균열	0.1 mm	0.25 m		67	균열	0.1 mm	0.4 m	
14	균열	0.1 mm	0.5 m		68	균열	0.2 mm	0.4 m	
15	균열	0.1 mm	0.8 m		69	균열	0.1 mm	0.4 m	
16	균열	0.1 mm	0.4 m		70	균열	0.1 mm	0.4 m	
17	균열	0.1 mm	0.5 m		71	균열	0.1 mm	0.4 m	
18	균열	0.1 mm	0.8 m		72	균열	0.1 mm	0.4 m	
19	균열	0.1 mm	0.4 m		73	방산 균열	0.4 mm	1.0 m	
20	균열	0.1 mm	0.5 m		74	균열	0.4 mm	1.6 m	
21	균열부 균열	0.1 mm	0.25 m		75	균열	0.2 mm	0.5 m	
22	균열	0.1 mm	0.8 m		76	균열	0.1 mm	0.4 m	
23	균열	0.1 mm	0.4 m		77	균열	0.1 mm	0.4 m	
24	균열	0.1 mm	0.4 m		78	균열	0.1 mm	0.4 m	
25	균열부 균열	0.1 mm	0.5 m		79	균열	0.1 mm	0.4 m	
26	균열부 균열	0.1 mm	0.25 m		80	균열	0.1 mm	0.4 m	
27	균열	0.1 mm	0.5 m		81	균열	0.1 mm	0.4 m	
28	균열	0.1 mm	0.8 m		82	균열	0.1 mm	0.4 m	
29	균열부 균열	0.1 mm	0.25 m		83	균열	0.3 mm	0.4 m	
30	균열	0.1 mm	0.8 m		84	균열	0.2 mm	0.4 m	
31	균열	0.1 mm	0.8 m		85				
32	균열	0.1 mm	0.8 m		86				
33	균열	0.1 mm	0.8 m		87				
34	균열	0.1 mm	0.8 m		88				
35	균열	0.1 mm	0.5 m		89				
36	균열	0.1 mm	0.5 m		90				
37	균열	0.3 mm	0.4 m		91				
38	균열	0.1 mm	0.8 m		92				
39	균열	0.1 mm	0.8 m		93				
40	균열	0.3 mm	0.4 m		94				
41	균열부 균열	0.1 mm	0.25 m		95				
42	균열	0.1 mm	0.5 m		96				
43	균열	0.1 mm	0.8 m		97				
44	균열	0.1 mm	0.5 m		98				
45	균열부 균열	0.1 mm	0.25 m		99				
46	균열부 균열	0.1 mm	0.5 m		100				
47	균열	0.3 mm	0.4 m		101				
48	균열	0.1 mm	0.8 m		102				
49	균열	0.1 mm	0.5 m		103				
50	균열	0.1 mm	0.5 m		104				
51	균열	0.1 mm	0.5 m		105				
52	균열	0.2 mm	0.4 m		106				
53	균열	0.1 mm	0.5 m		107				
54	균열	0.1 mm	0.5 m		108				

[illegible]