


호남고속선 신작교-62(66.905~66.912km, S13-1)

66K905

66K912

13 SPAN - 1

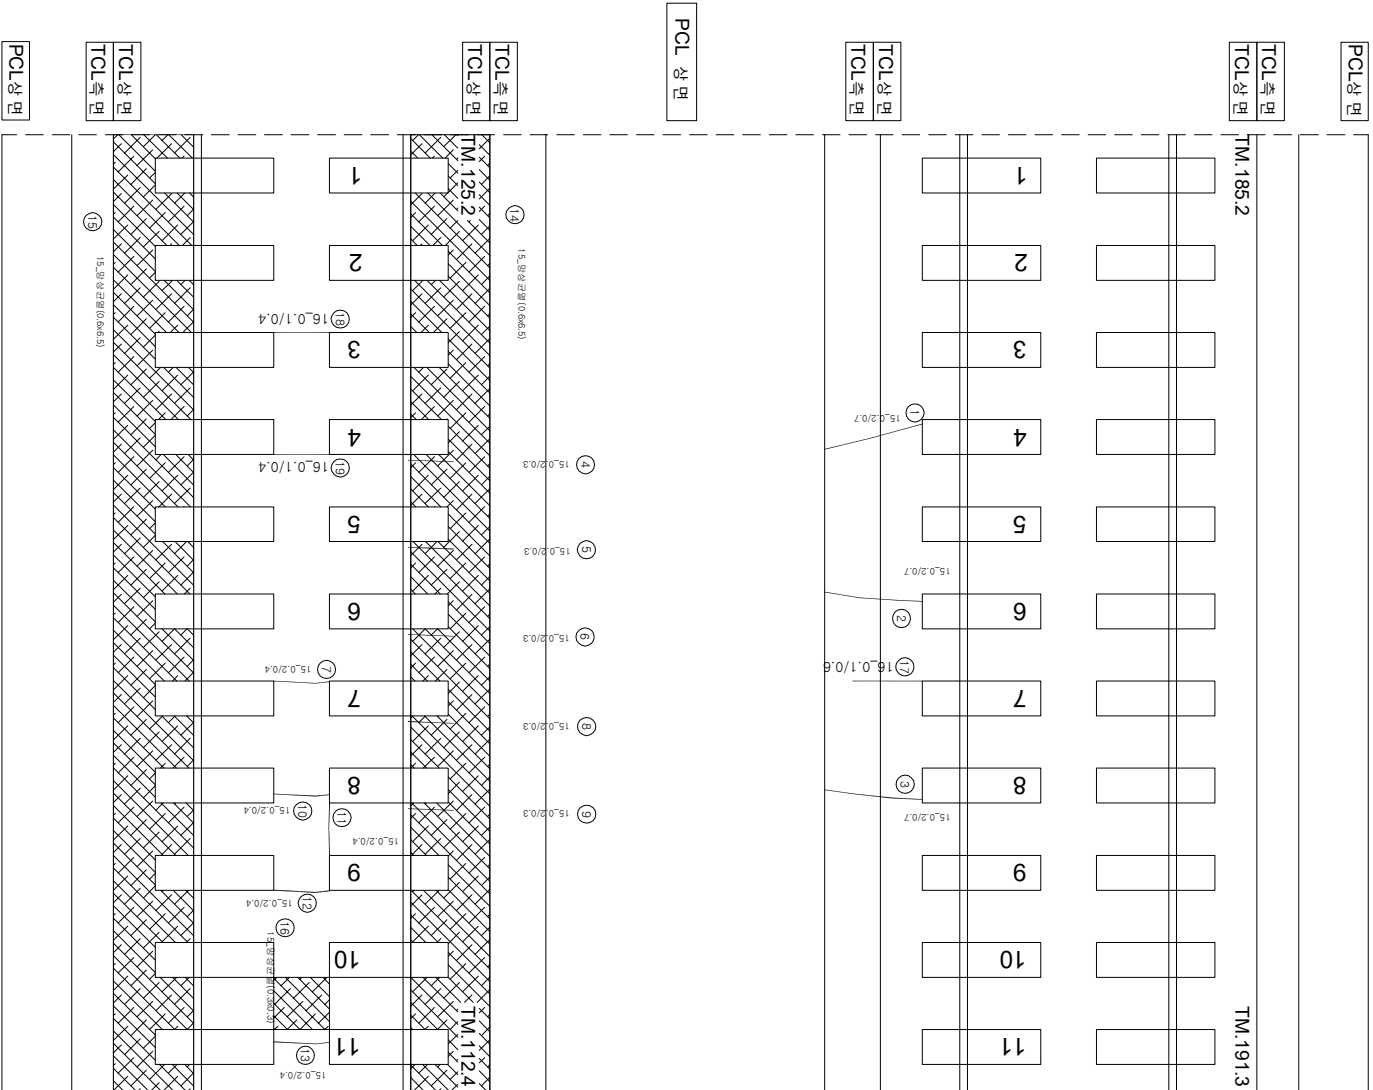

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.2 mm	0.7 m		55				
2	균열	0.2 mm	0.7 m		56				
3	균열	0.2 mm	0.3 m		57				
4	경계부 균열	0.2 mm	0.3 m		58				
5	경계부 균열	0.2 mm	0.3 m		59				
6	경계부 균열	0.2 mm	0.3 m		60				
7	경계부 균열	0.2 mm	0.4 m		61				
8	경계부 균열	0.2 mm	0.3 m		62				
9	경계부 균열	0.2 mm	0.3 m		63				
10	균열	0.2 mm	0.4 m		64				
11	균열	0.2 mm	0.4 m		65				
12	균열	0.2 mm	0.4 m		66				
13	균열	0.2 mm	0.4 m		67				
14	방산 균열	0.6 m	6.5 m		68				
15	방산 균열	0.6 m	6.5 m		69				
16	방산 균열	0.3 m	0.3 m		70				
17	균열	0.1 mm	0.6 m		71				
18	균열	0.1 mm	0.4 m		72				
19	균열	0.1 mm	0.4 m		73				
20					74				
21					75				
22					76				
23					77				
24					78				
25					79				
26					80				
27					81				
28					82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시행사	용역명	용역대상	주최·주요담당자	단	구분			
					개별 입찰	개별 입찰	개별 입찰	개별 입찰
한국철도공사 KOREA RAILROAD	2017년도 호남고속선 오송-광주승강간 콘크리트케도 정점용역	(주) 한국조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이 박 영 김 경 기 원 작 기	원		0.5m이하 : 흑색		호남고속선
						0.5m초과 0.5m이하 : 청색		호남고속선
						0.5m초과 0.5m이하 : 청색		호남고속선
						0.5m초과 1.0m미만 : 적색		호남고속선
						1.0m이상 : 분홍색		호남고속선