


호남고속선 아랑곡_토공노반_22(70.800~70.810km, L=10m)

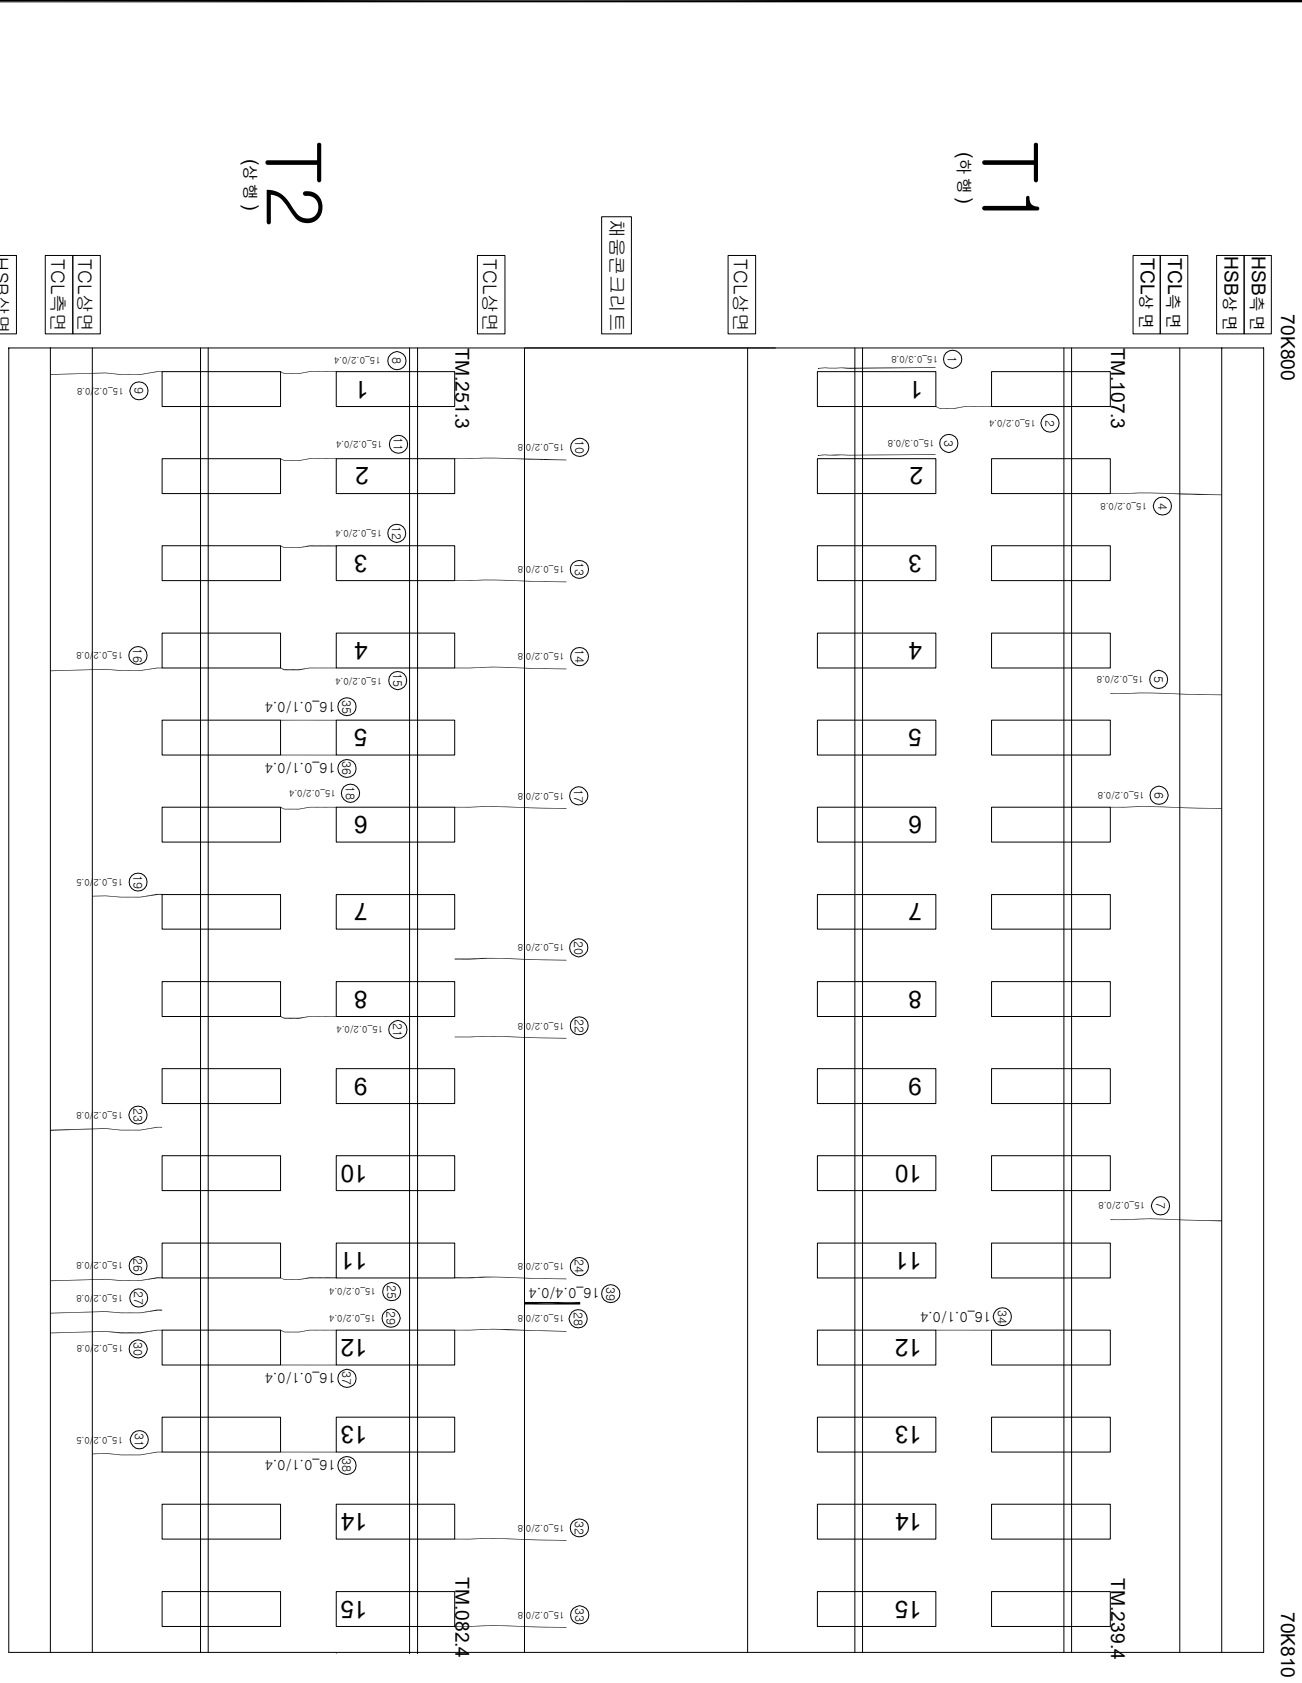

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	강계부 균열	0.3 mm	0.8 m		55				
2	균열	0.2 mm	0.4 m		56				
3	강계부 균열	0.3 mm	0.8 m		57				
4	균열	0.2 mm	0.8 m		58				
5	균열	0.2 mm	0.8 m		59				
6	균열	0.2 mm	0.8 m		60				
7	균열	0.2 mm	0.8 m		61				
8	균열	0.2 mm	0.4 m		62				
9	균열	0.2 mm	0.8 m		63				
10	균열	0.2 mm	0.8 m		64				
11	균열	0.2 mm	0.4 m		65				
12	균열	0.2 mm	0.4 m		66				
13	균열	0.2 mm	0.8 m		67				
14	균열	0.2 mm	0.8 m		68				
15	균열	0.2 mm	0.4 m		69				
16	균열	0.2 mm	0.8 m		70				
17	균열	0.2 mm	0.8 m		71				
18	균열	0.2 mm	0.4 m		72				
19	균열	0.2 mm	0.5 m		73				
20	균열	0.2 mm	0.8 m		74				
21	균열	0.2 mm	0.4 m		75				
22	균열	0.2 mm	0.8 m		76				
23	균열	0.2 mm	0.8 m		77				
24	균열	0.2 mm	0.8 m		78				
25	균열	0.2 mm	0.4 m		79				
26	균열	0.2 mm	0.8 m		80				
27	균열	0.2 mm	0.8 m		81				
28	균열	0.2 mm	0.8 m		82				
29	균열	0.2 mm	0.4 m		83				
30	균열	0.2 mm	0.8 m		84				
31	균열	0.2 mm	0.5 m		85				
32	균열	0.2 mm	0.8 m		86				
33	균열	0.2 mm	0.8 m		87				
34	균열	0.1 mm	0.4 m		88				
35	균열	0.1 mm	0.4 m		89				
36	균열	0.1 mm	0.4 m		90				
37	균열	0.1 mm	0.4 m		91				
38	균열	0.1 mm	0.4 m		92				
39	균열	0.4 mm	0.4 m		93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시	행	사	공	역	명	공	역	사	관		연	점	목	방	비고
									관	역					
KORAIL 한국철도공사															
2017년도 호남고속선 오송-광주송정간 콘크리트케도 점검용역															
(주) 한국구조물안전연구원 (주) 한국토목안전연구원 (재) 한국건설품질연구원															
이 부영															
간음길 김정기 문은석 기															
〰〰〰															