


하마고산역-토아노반-57(71.150~71.160km, L=10m)

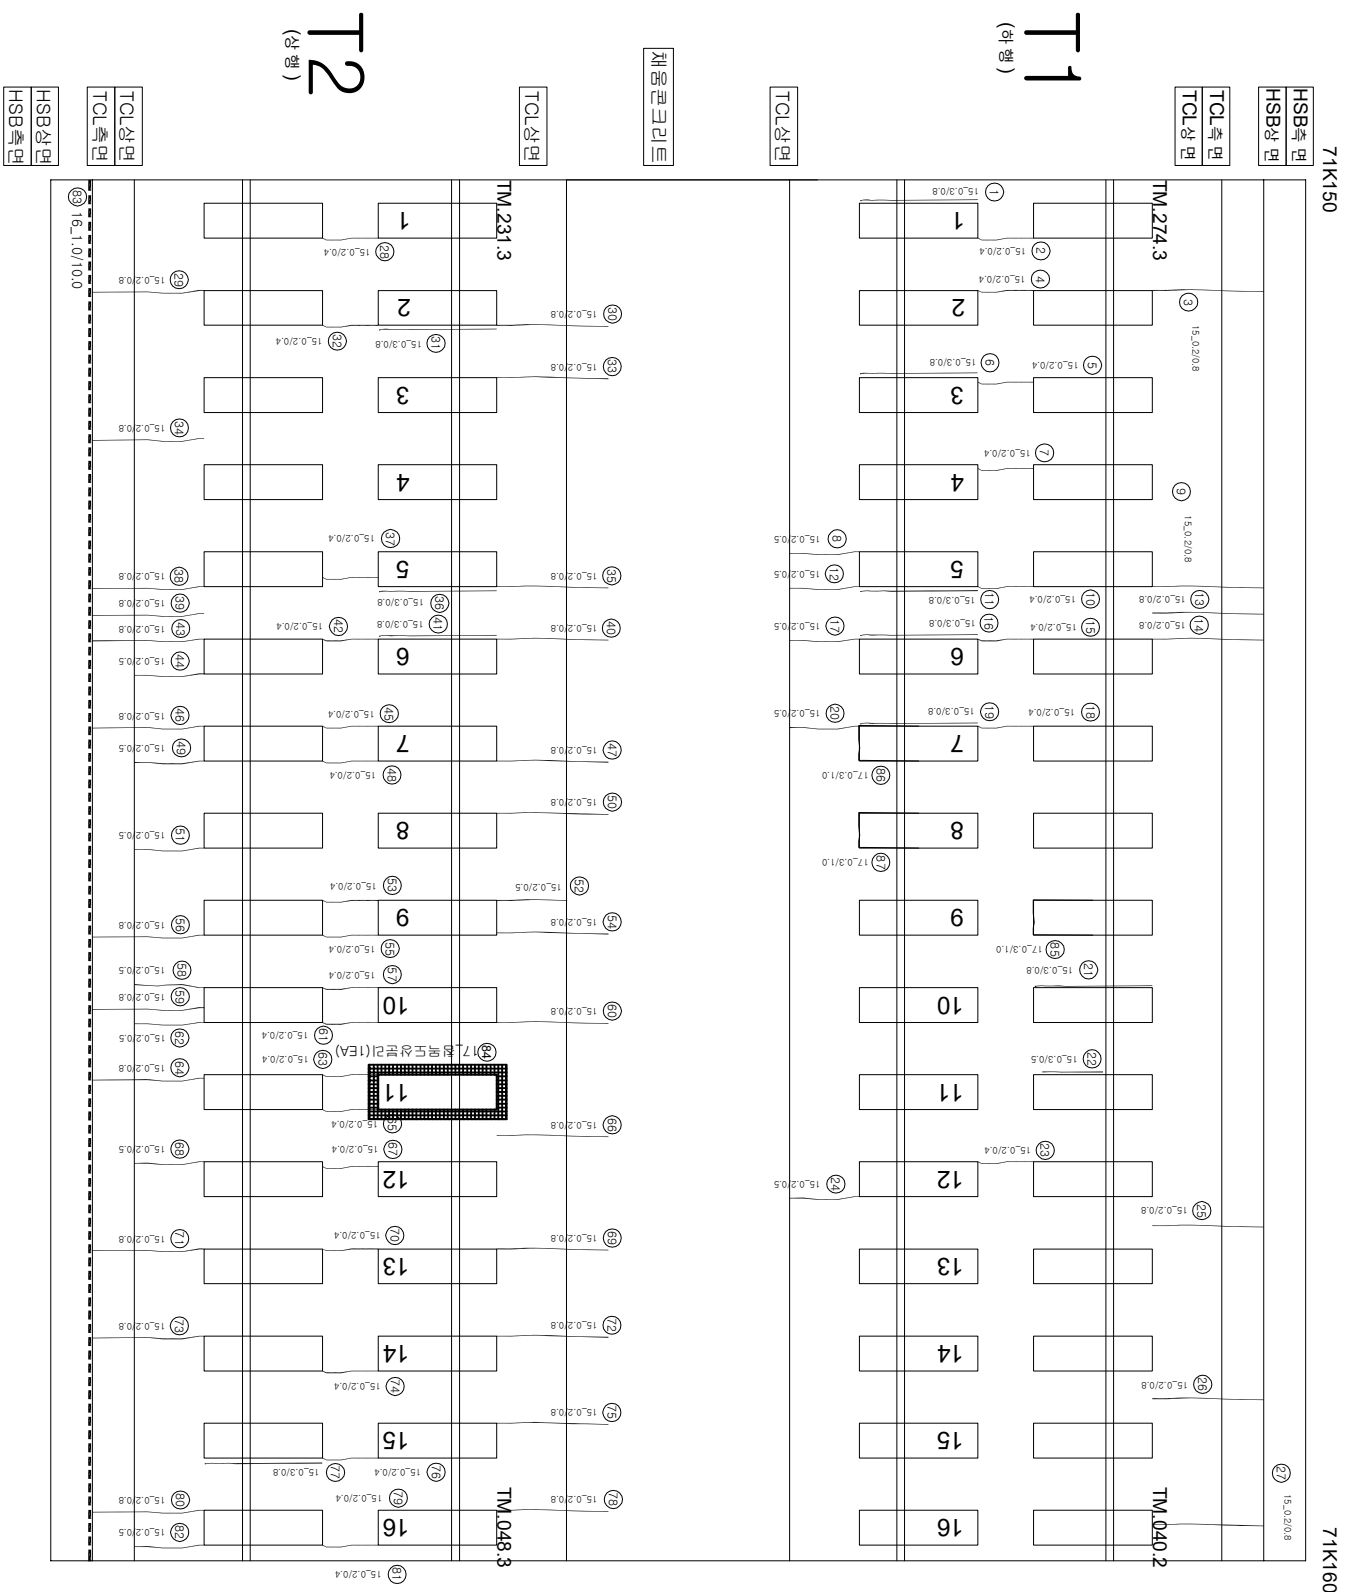

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	강제부 균열	0.3 mm	0.8 m		55	균열	0.1 mm	0.4 m	
2	균열	0.2 mm	0.4 m		56	균열	0.2 mm	0.8 m	
3	균열	0.2 mm	0.4 m		57	균열	0.2 mm	0.4 m	
4	균열	0.2 mm	0.8 m		58	균열	0.2 mm	0.5 m	
5	균열	0.2 mm	0.4 m		59	균열	0.2 mm	0.8 m	
6	강제부 균열	0.3 mm	0.8 m		60	균열	0.2 mm	0.8 m	
7	균열	0.2 mm	0.4 m		61	균열	0.2 mm	0.4 m	
8	균열	0.2 mm	0.5 m		62	균열	0.2 mm	0.5 m	
9	균열	0.2 mm	0.8 m		63	균열	0.2 mm	0.4 m	
10	균열	0.2 mm	0.4 m		64	균열	0.2 mm	0.8 m	
11	강제부 균열	0.3 mm	0.8 m		65	균열	0.2 mm	0.4 m	
12	균열	0.2 mm	0.5 m		66	균열	0.2 mm	0.8 m	
13	균열	0.2 mm	0.8 m		67	균열	0.2 mm	0.4 m	
14	균열	0.2 mm	0.8 m		68	균열	0.2 mm	0.5 m	
15	균열	0.2 mm	0.4 m		69	균열	0.2 mm	0.8 m	
16	강제부 균열	0.3 mm	0.8 m		70	균열	0.2 mm	0.4 m	
17	균열	0.2 mm	0.5 m		71	균열	0.2 mm	0.8 m	
18	균열	0.2 mm	0.4 m		72	균열	0.2 mm	0.8 m	
19	강제부 균열	0.3 mm	0.8 m		73	균열	0.2 mm	0.8 m	
20	균열	0.2 mm	0.5 m		74	균열	0.2 mm	0.4 m	
21	강제부 균열	0.3 mm	0.8 m		75	균열	0.2 mm	0.8 m	
22	강제부 균열	0.3 mm	0.8 m		76	균열	0.2 mm	0.4 m	
23	균열	0.2 mm	0.4 m		77	강제부 균열	0.3 mm	0.8 m	
24	균열	0.2 mm	0.5 m		78	균열	0.2 mm	0.8 m	
25	균열	0.2 mm	0.8 m		79	균열	0.2 mm	0.4 m	
26	균열	0.2 mm	0.8 m		80	균열	0.2 mm	0.8 m	
27	균열	0.2 mm	0.8 m		81	균열	0.2 mm	0.4 m	
28	균열	0.2 mm	0.4 m		82	균열	0.2 mm	0.5 m	
29	균열	0.2 mm	0.8 m		83	충돌리	1.0 mm	10.0 m	신규
30	균열	0.2 mm	0.8 m		84	점록도상분리		1.0 ea	신규
31	강제부 균열	0.3 mm	0.8 m		85	강제부 균열	0.3 mm	1.0 m	신규
32	균열	0.2 mm	0.4 m		86	강제부 균열	0.3 mm	1.0 m	신규
33	균열	0.2 mm	0.8 m		87	강제부 균열	0.3 mm	1.0 m	신규
34	균열	0.2 mm	0.8 m		88				
35	강제부 균열	0.3 mm	0.8 m		89				
36	강제부 균열	0.3 mm	0.8 m		90				
37	균열	0.2 mm	0.4 m		91				
38	균열	0.2 mm	0.8 m		92				
39	균열	0.2 mm	0.8 m		93				
40	균열	0.2 mm	0.8 m		94				
41	강제부 균열	0.3 mm	0.8 m		95				
42	균열	0.2 mm	0.4 m		96				
43	균열	0.2 mm	0.8 m		97				
44	균열	0.2 mm	0.5 m		98				
45	균열	0.2 mm	0.4 m		99				
46	균열	0.2 mm	0.8 m		100				
47	균열	0.2 mm	0.8 m		101				
48	균열	0.2 mm	0.4 m		102				
49	균열	0.2 mm	0.5 m		103				
50	균열	0.2 mm	0.8 m		104				
51	균열	0.2 mm	0.5 m		105				
52	균열	0.2 mm	0.5 m		106				
53	균열	0.2 mm	0.4 m		107				
54	균열	0.2 mm	0.8 m		108				

한국철도공사 KOREA RAILCOO	시행사	공역명	공역사	(주) 한국국조물안전연구원 (주) 한국도안안전연구원 (제) 한국건설품질안전연구원	이북영		구간	0.220 (0.300이하) : 복선 0.420 (0.300초과 0.500이하) : 정선 0.620 (0.500초과 1.000이하) : 정선 1.020 (1.000이상) : 분류선	침목본리	0.220 (0.300초과 0.500이하) : 정선 0.420 (0.300초과 0.500이하) : 정선 0.620 (0.500초과 1.000이하) : 정선 1.020 (1.000이상) : 분류선	재운본리	
					과업명	공사명						
					과업명	공사명						
					과업명	공사명						
					과업명	공사명						
					라온강 김경기 윤석기			0.220 (0.300이하) : 복선 0.420 (0.300초과 0.500이하) : 정선 0.620 (0.500초과 1.000이하) : 정선 1.020 (1.000이상) : 분류선	양신	0.220 (0.300초과 0.500이하) : 정선 0.420 (0.300초과 0.500이하) : 정선 0.620 (0.500초과 1.000이하) : 정선 1.020 (1.000이상) : 분류선	박리,박리,파산	누수수원부
								양영	시공이음본리,종본리			