


한남고속선 화곡-토아노반-49(72.870~72.880km, L=10m)

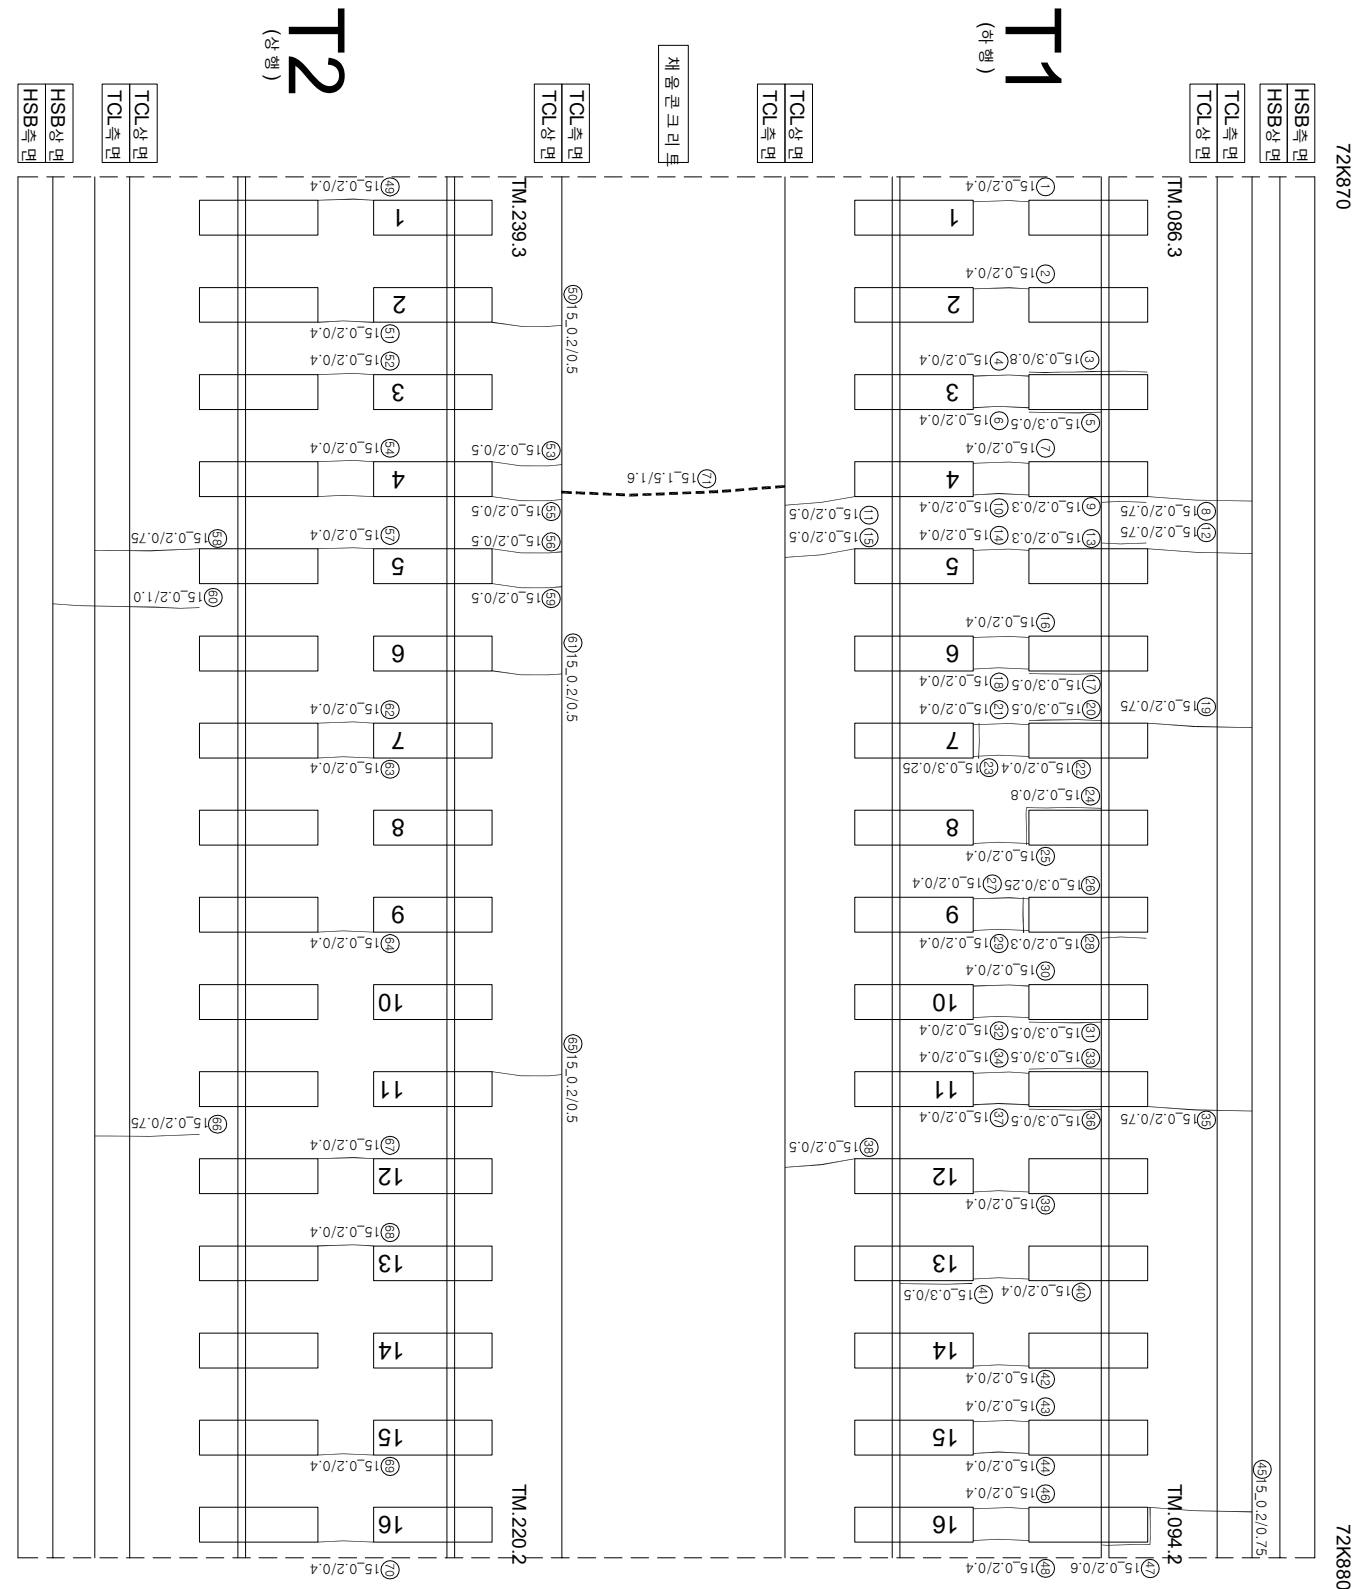

| 연번 | 구분     | 소재     | 면적     | 비고 | 연번  | 구분 | 소재     | 면적     | 비고 |
|----|--------|--------|--------|----|-----|----|--------|--------|----|
| 1  | 군영     | 0.2 mm | 0.4 m  |    | 55  | 군영 | 0.2 mm | 0.5 m  |    |
| 2  | 군영     | 0.2 mm | 0.4 m  |    | 56  | 군영 | 0.2 mm | 0.5 m  |    |
| 3  | 장제부 군영 | 0.3 mm | 0.8 m  |    | 57  | 군영 | 0.2 mm | 0.4 m  |    |
| 4  | 군영     | 0.2 mm | 0.4 m  |    | 58  | 군영 | 0.2 mm | 0.75 m |    |
| 5  | 장제부 군영 | 0.3 mm | 0.5 m  |    | 59  | 군영 | 0.2 mm | 0.5 m  |    |
| 6  | 군영     | 0.2 mm | 0.4 m  |    | 60  | 군영 | 0.2 mm | 1 m    |    |
| 7  | 군영     | 0.2 mm | 0.4 m  |    | 61  | 군영 | 0.2 mm | 0.5 m  |    |
| 8  | 군영     | 0.2 mm | 0.75 m |    | 62  | 군영 | 0.2 mm | 0.4 m  |    |
| 9  | 장제부 군영 | 0.2 mm | 0.3 m  |    | 63  | 군영 | 0.2 mm | 0.4 m  |    |
| 10 | 군영     | 0.2 mm | 0.4 m  |    | 64  | 군영 | 0.2 mm | 0.4 m  |    |
| 11 | 군영     | 0.2 mm | 0.5 m  |    | 65  | 군영 | 0.2 mm | 0.5 m  |    |
| 12 | 군영     | 0.2 mm | 0.75 m |    | 66  | 군영 | 0.2 mm | 0.75 m |    |
| 13 | 장제부 군영 | 0.2 mm | 0.3 m  |    | 67  | 군영 | 0.2 mm | 0.4 m  |    |
| 14 | 군영     | 0.2 mm | 0.4 m  |    | 68  | 군영 | 0.2 mm | 0.4 m  |    |
| 15 | 군영     | 0.2 mm | 0.5 m  |    | 69  | 군영 | 0.2 mm | 0.4 m  |    |
| 16 | 군영     | 0.2 mm | 0.4 m  |    | 70  | 군영 | 0.2 mm | 0.4 m  |    |
| 17 | 장제부 군영 | 0.3 mm | 0.5 m  |    | 71  | 군영 | 1.5 mm | 1.6 m  |    |
| 18 | 군영     | 0.2 mm | 0.4 m  |    | 72  |    |        |        |    |
| 19 | 군영     | 0.2 mm | 0.75 m |    | 73  |    |        |        |    |
| 20 | 장제부 군영 | 0.3 mm | 0.5 m  |    | 74  |    |        |        |    |
| 21 | 군영     | 0.2 mm | 0.4 m  |    | 75  |    |        |        |    |
| 22 | 군영     | 0.2 mm | 0.4 m  |    | 76  |    |        |        |    |
| 23 | 장제부 군영 | 0.3 mm | 0.25 m |    | 77  |    |        |        |    |
| 24 | 장제부 군영 | 0.2 mm | 0.8 m  |    | 78  |    |        |        |    |
| 25 | 군영     | 0.2 mm | 0.4 m  |    | 79  |    |        |        |    |
| 26 | 장제부 군영 | 0.3 mm | 0.25 m |    | 80  |    |        |        |    |
| 27 | 군영     | 0.2 mm | 0.4 m  |    | 81  |    |        |        |    |
| 28 | 장제부 군영 | 0.2 mm | 0.3 m  |    | 82  |    |        |        |    |
| 29 | 군영     | 0.2 mm | 0.4 m  |    | 83  |    |        |        |    |
| 30 | 군영     | 0.2 mm | 0.4 m  |    | 84  |    |        |        |    |
| 31 | 장제부 군영 | 0.3 mm | 0.5 m  |    | 85  |    |        |        |    |
| 32 | 군영     | 0.2 mm | 0.4 m  |    | 86  |    |        |        |    |
| 33 | 장제부 군영 | 0.3 mm | 0.5 m  |    | 87  |    |        |        |    |
| 34 | 군영     | 0.2 mm | 0.4 m  |    | 88  |    |        |        |    |
| 35 | 군영     | 0.2 mm | 0.75 m |    | 89  |    |        |        |    |
| 36 | 장제부 군영 | 0.3 mm | 0.5 m  |    | 90  |    |        |        |    |
| 37 | 군영     | 0.2 mm | 0.4 m  |    | 91  |    |        |        |    |
| 38 | 군영     | 0.2 mm | 0.5 m  |    | 92  |    |        |        |    |
| 39 | 군영     | 0.2 mm | 0.4 m  |    | 93  |    |        |        |    |
| 40 | 군영     | 0.2 mm | 0.4 m  |    | 94  |    |        |        |    |
| 41 | 장제부 군영 | 0.3 mm | 0.5 m  |    | 95  |    |        |        |    |
| 42 | 군영     | 0.2 mm | 0.4 m  |    | 96  |    |        |        |    |
| 43 | 군영     | 0.2 mm | 0.4 m  |    | 97  |    |        |        |    |
| 44 | 군영     | 0.2 mm | 0.4 m  |    | 98  |    |        |        |    |
| 45 | 군영     | 0.2 mm | 0.75 m |    | 99  |    |        |        |    |
| 46 | 군영     | 0.2 mm | 0.4 m  |    | 100 |    |        |        |    |
| 47 | 장제부 군영 | 0.2 mm | 0.6 m  |    | 101 |    |        |        |    |
| 48 | 군영     | 0.2 mm | 0.4 m  |    | 102 |    |        |        |    |
| 49 | 군영     | 0.2 mm | 0.4 m  |    | 103 |    |        |        |    |
| 50 | 군영     | 0.2 mm | 0.5 m  |    | 104 |    |        |        |    |
| 51 | 군영     | 0.2 mm | 0.4 m  |    | 105 |    |        |        |    |
| 52 | 군영     | 0.2 mm | 0.4 m  |    | 106 |    |        |        |    |
| 53 | 군영     | 0.2 mm | 0.5 m  |    | 107 |    |        |        |    |
| 54 | 군영     | 0.2 mm | 0.4 m  |    | 108 |    |        |        |    |

| 시행사                                | 용역명                               | 용역사                                              | 이복영                      |           | 구간                                                                                                            |                                                                                     |            |                                                                                     |              |                                                                                     |
|------------------------------------|-----------------------------------|--------------------------------------------------|--------------------------|-----------|---------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|------------|-------------------------------------------------------------------------------------|--------------|-------------------------------------------------------------------------------------|
|                                    |                                   |                                                  | 개설 전 지                   | 분야 별 개설 지 |                                                                                                               |                                                                                     |            |                                                                                     |              |                                                                                     |
| KORAIL<br>KOREA RAILROAD<br>한국철도공사 | 2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검공역 | (주) 한국국조물안전연구원<br>(주) 한국국토안전연구원<br>(재) 한국건설품질연구원 | 이복영<br>김원강<br>김경기<br>문준석 | 원         |  0220 (0.3m이하 : 철석)        |  | 차료분리       |  |              |                                                                                     |
|                                    |                                   |                                                  |                          |           |  0420 (0.3m초과 0.5m이하 : 형석) |  | 방상         |  | 철타노출         |  |
|                                    |                                   |                                                  |                          |           |  0620 (0.5m초과 1.0m이하 : 적석) |  | 박리, 박락, 파손 |  | 누수, 음운부      |  |
|                                    |                                   |                                                  |                          |           |  1020 (1.0m이상 : 분홍색)       |  | 백태         |  | 오염           |  |
|                                    |                                   |                                                  |                          |           |                            |  |            |  | 시공이음 분리, 종분리 |  |
|                                    |                                   |                                                  |                          |           |                            |  |            |  |              |  |