


한남고속선 죽산교_230(74.662~74.668km, S46-4)

74K668

74K662

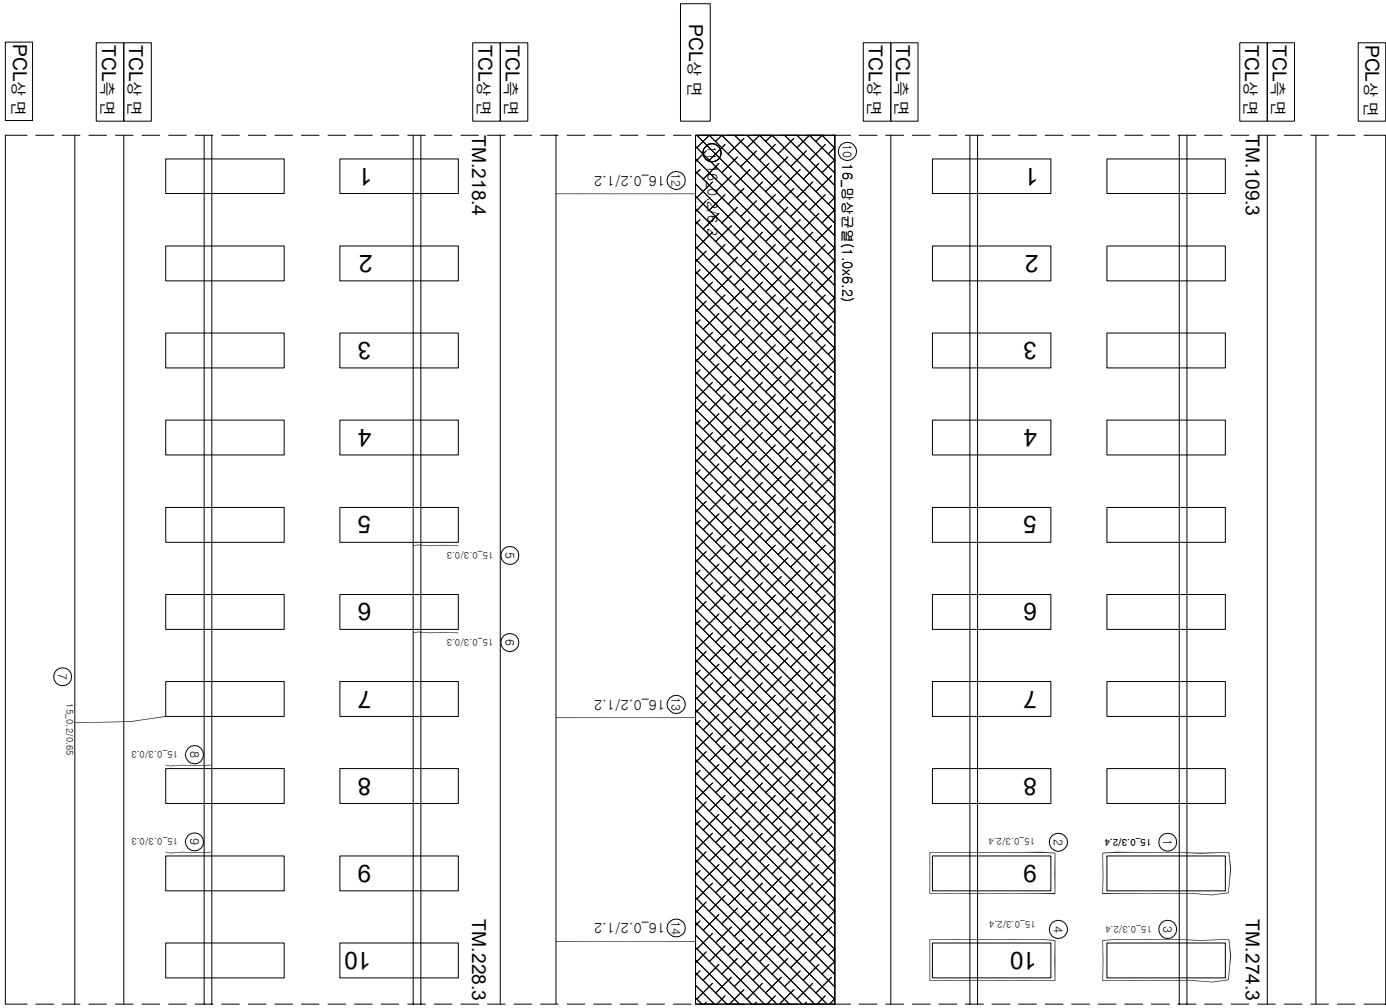

가
(아
0앞
)

(하
0호)

T2
(0_T 0_H)

(가)

연번	산선	폭	연장	비고	연번	산선	폭	연장	비고
1	강계부 군열	0.3	mm	2.4 m	55				
2	강계부 군열	0.3	mm	2.4 m	56				
3	강계부 군열	0.3	mm	2.4 m	57				
4	강계부 군열	0.3	mm	2.4 m	58				
5	강계부 군열	0.3	mm	0.3 m	59				
6	강계부 군열	0.3	mm	0.3 m	60				
7	군열	0.2	mm	0.65 m	61				
8	강계부 군열	0.3	mm	0.3 m	62				
9	강계부 군열	0.3	mm	0.3 m	63				
10	망상군열	1.0	mm	6.2 m	6.23 ^m	64			
11	군열	0.2	mm	1.2 m	65				
12	군열	0.2	mm	1.2 m	66				
13	군열	0.2	mm	1.2 m	67				
14					68				
15					69				
16					70				
17					71				
18					72				
19					73				
20					74				
21					75				
22					76				
23					77				
24					78				
25					79				
26					80				
27					81				
28					82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시	행 사	영역	영역	영역	사	과목		단							
						개	인		장	아					
						제	원 지	본	아	원 지					
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검공역	(주) 한국구조물안전연구원 (주) 한국국토안전연구원 (재) 한국건설품질연구원	이 부영	김 원 강 김 경 기 문 윤 석	영원		0220	(0.3mm이하 : 흑색)		참목도상분리		재료분리		
								0420	(0.3mm초과 0.5mm이하 : 황색)		망상		철판노출		
								0620	(0.5mm초과 1.0mm미만 : 적색)		박리, 박락, 파손		누수, 슬럼프		
								1020	(1.0mm이상 : 분홍색)		백태		오염	시공이음 분리, 종분리	
															