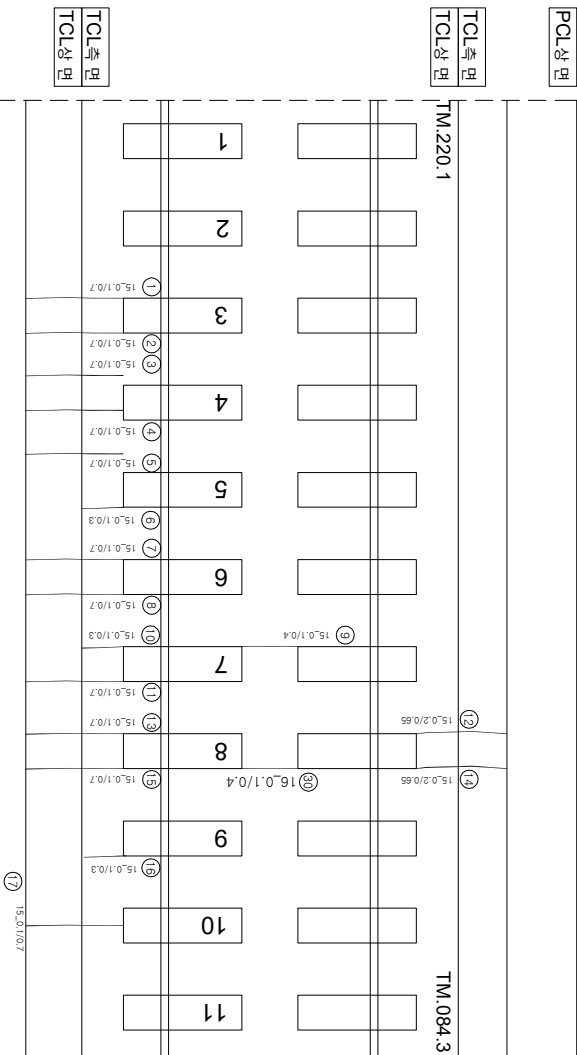


호남고속선 죽산교-339(75.409~75.416km, S68-3)


75K416

75K409


$$\left(\begin{array}{c} \text{아} \\ \text{하} \end{array} \right) \left(\begin{array}{c} \text{아} \\ \text{호} \end{array} \right)$$

(아
아)

PCL상면

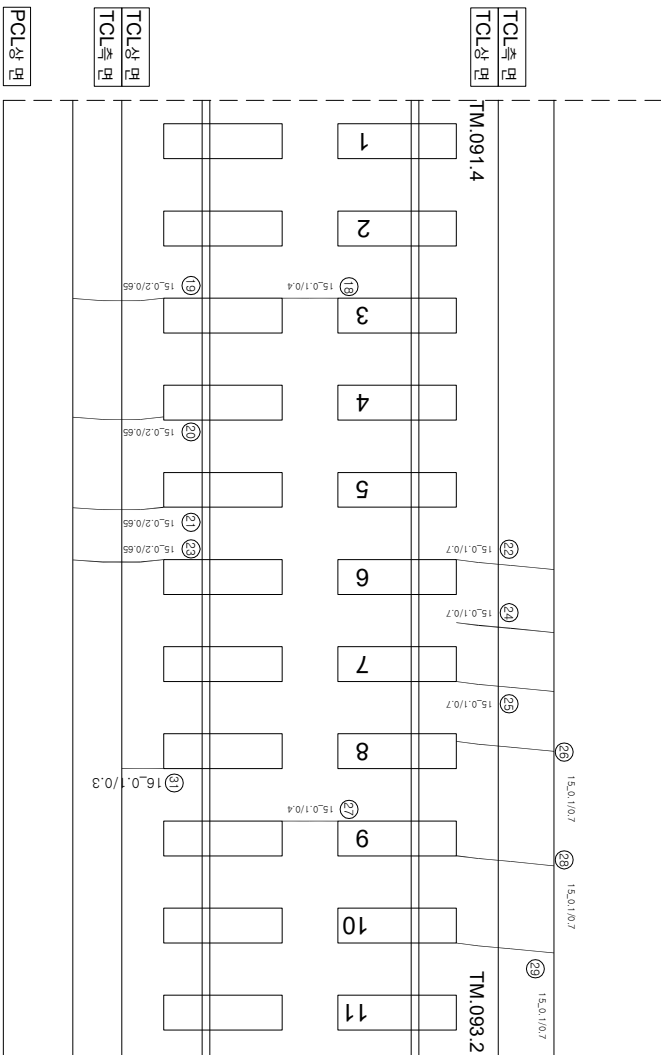

T2
(0_T 0_H)

(악향)

연번	산선	목	연장	비고	연번	산선	목	연장	비고
1	균열	0.1 mm	0.7 m	m	55				
2	균열	0.1 mm	0.7 m		56				
3	균열	0.1 mm	0.7 m		57				
4	균열	0.1 mm	0.7 m		58				
5	균열	0.1 mm	0.7 m		59				
6	균열	0.1 mm	0.3 m		60				
7	균열	0.1 mm	0.7 m		61				
8	균열	0.1 mm	0.7 m		62				
9	균열	0.1 mm	0.4 m		63				
10	균열	0.1 mm	0.3 m		64				
11	균열	0.1 mm	0.7 m		65				
12	균열	0.2 mm	0.65 m		66				
13	균열	0.1 mm	0.7 m		67				
14	균열	0.2 mm	0.65 m		68				
15	균열	0.1 mm	0.7 m		69				
16	균열	0.1 mm	0.3 m		70				
17	균열	0.1 mm	0.7 m		71				
18	균열	0.1 mm	0.4 m		72				
19	균열	0.2 mm	0.65 m		73				
20	균열	0.2 mm	0.65 m		74				
21	균열	0.2 mm	0.65 m		75				
22	균열	0.1 mm	0.7 m		76				
23	균열	0.2 mm	0.65 m		77				
24	균열	0.1 mm	0.7 m		78				
25	균열	0.1 mm	0.7 m		79				
26	균열	0.1 mm	0.7 m		80				
27	균열	0.1 mm	0.4 m		81				
28	균열	0.1 mm	0.7 m		82				
29	균열	0.1 mm	0.7 m		83				
30	균열	0.1 mm	0.4 m		84				
31	균열	0.1 mm	0.3 m		85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시	행 사	영 역	영 역	공 공 사	관 령 지		구 간		
					개 입 전 지	완 성 후 지			
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검용역	(주) 한국구조물안전연구원 (주) 한국국토안전연구원 (재) 한국건설품질연구원	이 부 영 김 원 강 김 경 기 문 은 석	관 령 지	구 간	 0.220 (0.3mm이하 : 흑색)	 한목대소방관리	 차료관리
							 0.420 (0.3mm초과 0.5mm이하 : 황색)	 양상	 철타노출
							 0.620 (0.5mm초과 1.0mm미만 : 적색)	 박리, 박락, 파손	 누수, 슬럼부
							 1.020 (1.0mm이상 : 분홍색)	 백태	 시공이음 분리, 총관리
							 1.020 (1.0mm이상 : 분홍색)	 백태	 누수, 슬럼부