


한남고속선 공리표_25 (75.867~75.874km, S5-4)

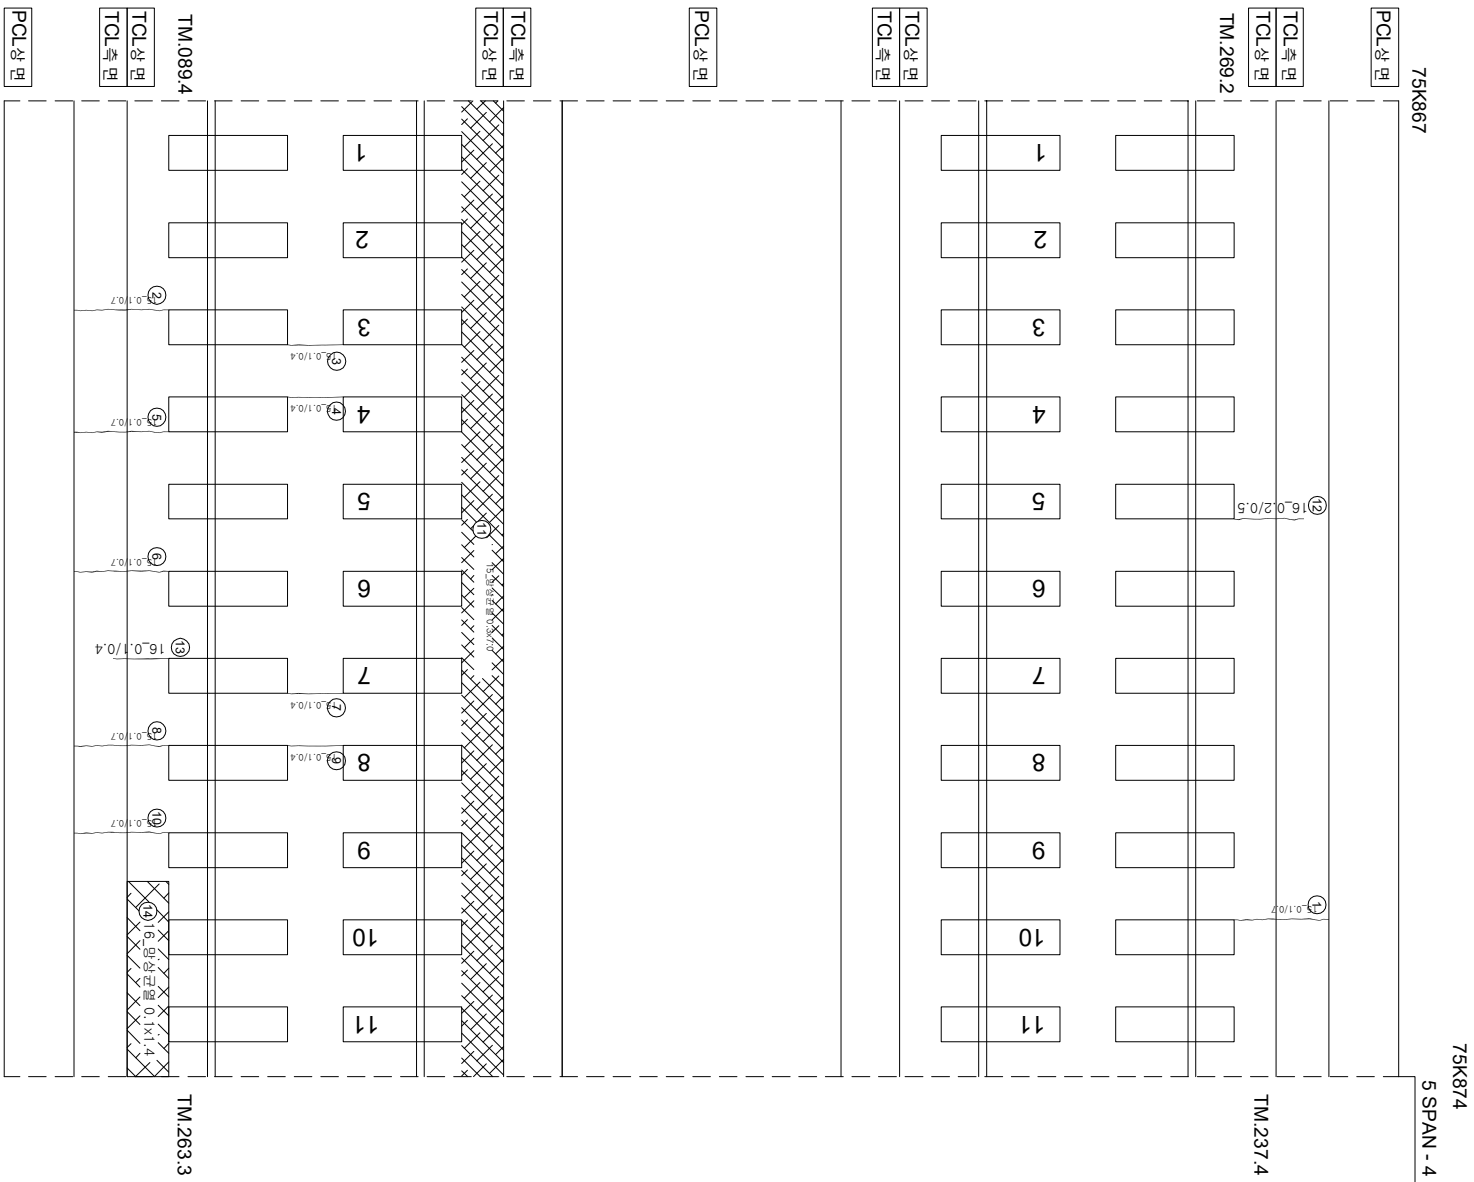

구분	순상	폭	연장	비고	구분	순상	폭	연장
1	균열	0.1 mm	0.7 m		55			
2	균열	0.1 mm	0.7 m		56			
3	균열	0.1 mm	0.4 m		57			
4	균열	0.1 mm	0.4 m		58			
5	균열	0.1 mm	0.7 m		59			
6	균열	0.1 mm	0.7 m		60			
7	균열	0.1 mm	0.4 m		61			
8	균열	0.1 mm	0.7 m		62			
9	균열	0.1 mm	0.4 m		63			
10	균열	0.1 mm	0.7 m		64			
11	망상균열	0.3 mm	7.0 m		65			
12	균열	0.2 mm	0.5 m		66			
13	균열	0.1 mm	0.4 m		67			
14	망상균열	0.1 m	1.4 m		68			
15					69			
16					70			
17					71			
18					72			
19					73			
20					74			
21					75			
22					76			
23					77			
24					78			
25					79			
26					80			
27					81			
28					82			
29					83			
30					84			
31					85			
32					86			
33					87			
34					88			
35					89			
36					90			
37					91			
38					92			
39					93			
40					94			
41					95			
42					96			
43					97			
44					98			
45					99			
46					100			
47					101			
48					102			
49					103			
50					104			
51					105			
52					106			
53					107			
54					108			

시	행 사	영역	영역명	영역사	관리인		구간			
					책임자	분야별임의				
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검영역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이 복 영	김 원 강 김 경 기 문 은 석	구간	 0.220 (0.3mm이하 : 흑색)	 점목도상판리	 재료분리	
						 0.420 (0.3mm초과 0.5mm이하 : 황색)	 양상	 철판노출		
						 0.620 (0.5mm초과 1.0mm미만 : 적색)	 박리, 박락, 파손	 누수, 슬럼프		
						 1.020 (1.0mm이상 : 분홍색)	 백태	 시공이음분리, 종분리		