

호남고속선 중리교_36 (75.944~75.951km, S7-5)

75K944

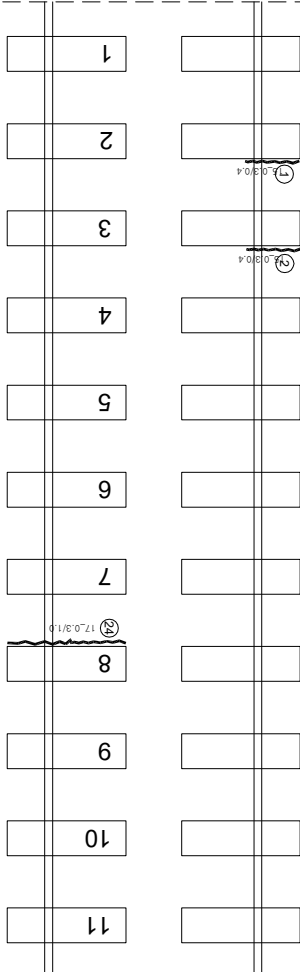
75K951
7 SPAN - 5

PCL상표명

TCL 美	TCL 상
-------	-------

TM.215.3

TM.090.4


$$\left(\frac{a}{b}\right)$$

(아
0원)

TCL 상	TCL 하
-------	-------

PCL상표

② $16-0.2/1.2$

TCL 中国	TCL 中国
--------	--------

$$\begin{pmatrix} 0 \\ 0 \end{pmatrix}$$
$$\begin{pmatrix} 0 & 1 \\ 0 & 0 \end{pmatrix}$$

TM.103.3

TM.098.1

TCL 상	TCL
TCL 클	TCL

PCL상면

P7

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.3 mm	0.4 m		55				
2	균열	0.3 mm	0.4 m		56				
3	균열	0.1 mm	0.7 m		57				
4	균열	0.1 mm	0.4 m		58				
5	균열	0.1 mm	0.4 m		59				
6	균열	0.1 mm	0.4 m		60				
7	균열	0.1 mm	0.4 m		61				
8	균열	0.1 mm	0.3 m		62				
9	균열	0.1 mm	0.4 m		63				
10	균열	0.1 mm	0.3 m		64				
11	균열	0.1 mm	0.4 m		65				
12	균열	0.1 mm	0.3 m		66				
13	균열	0.1 mm	0.4 m		67				
14	균열	0.1 mm	0.4 m		68				
15	균열	0.1 mm	0.4 m		69				
16	균열	0.1 mm	0.3 m		70				
17	균열	0.1 mm	0.4 m		71				
18	균열	0.1 mm	0.3 m		72				
19	균열	0.1 mm	0.4 m		73				
20	균열	0.2 mm	0.4 m		74				
21	균열	0.2 mm	1.2 m		75				
22	균열	0.2 mm	0.5 m		76				
23	균열	0.1 mm	0.4 m		77				
24	경계부 균열	0.3 mm	1.0 m	신규	78				
25					79				
26					80				
27					81				
28					82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시	행 사	영 역	영 역	영 역	사	과 임 전		장	아 지	단			
						개	임 지				분 아	발 적 임 지	
KORAIL KOREA RAILROAD 한국철도공사		2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검공역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이 복 영	간 원 강 김 경 기 문 원 석 기	영원		0220 (0.3mm이하 : 흑색)		참목도상판리		재료판리	
								0420 (0.3mm초과 0.5mm이하 : 황색)		망상		철판노출	
								0620 (0.5mm초과 1.0mm미만 : 적색)		박리, 박락, 파손		누수, 슬럼프	
								1020 (1.0mm이상 : 분홍색)		백태		오염	
												시공이음판리, 종판리	
													