


하남고수선종리교_토양노반 18_ (76.987~76.997km, L=10.4m)

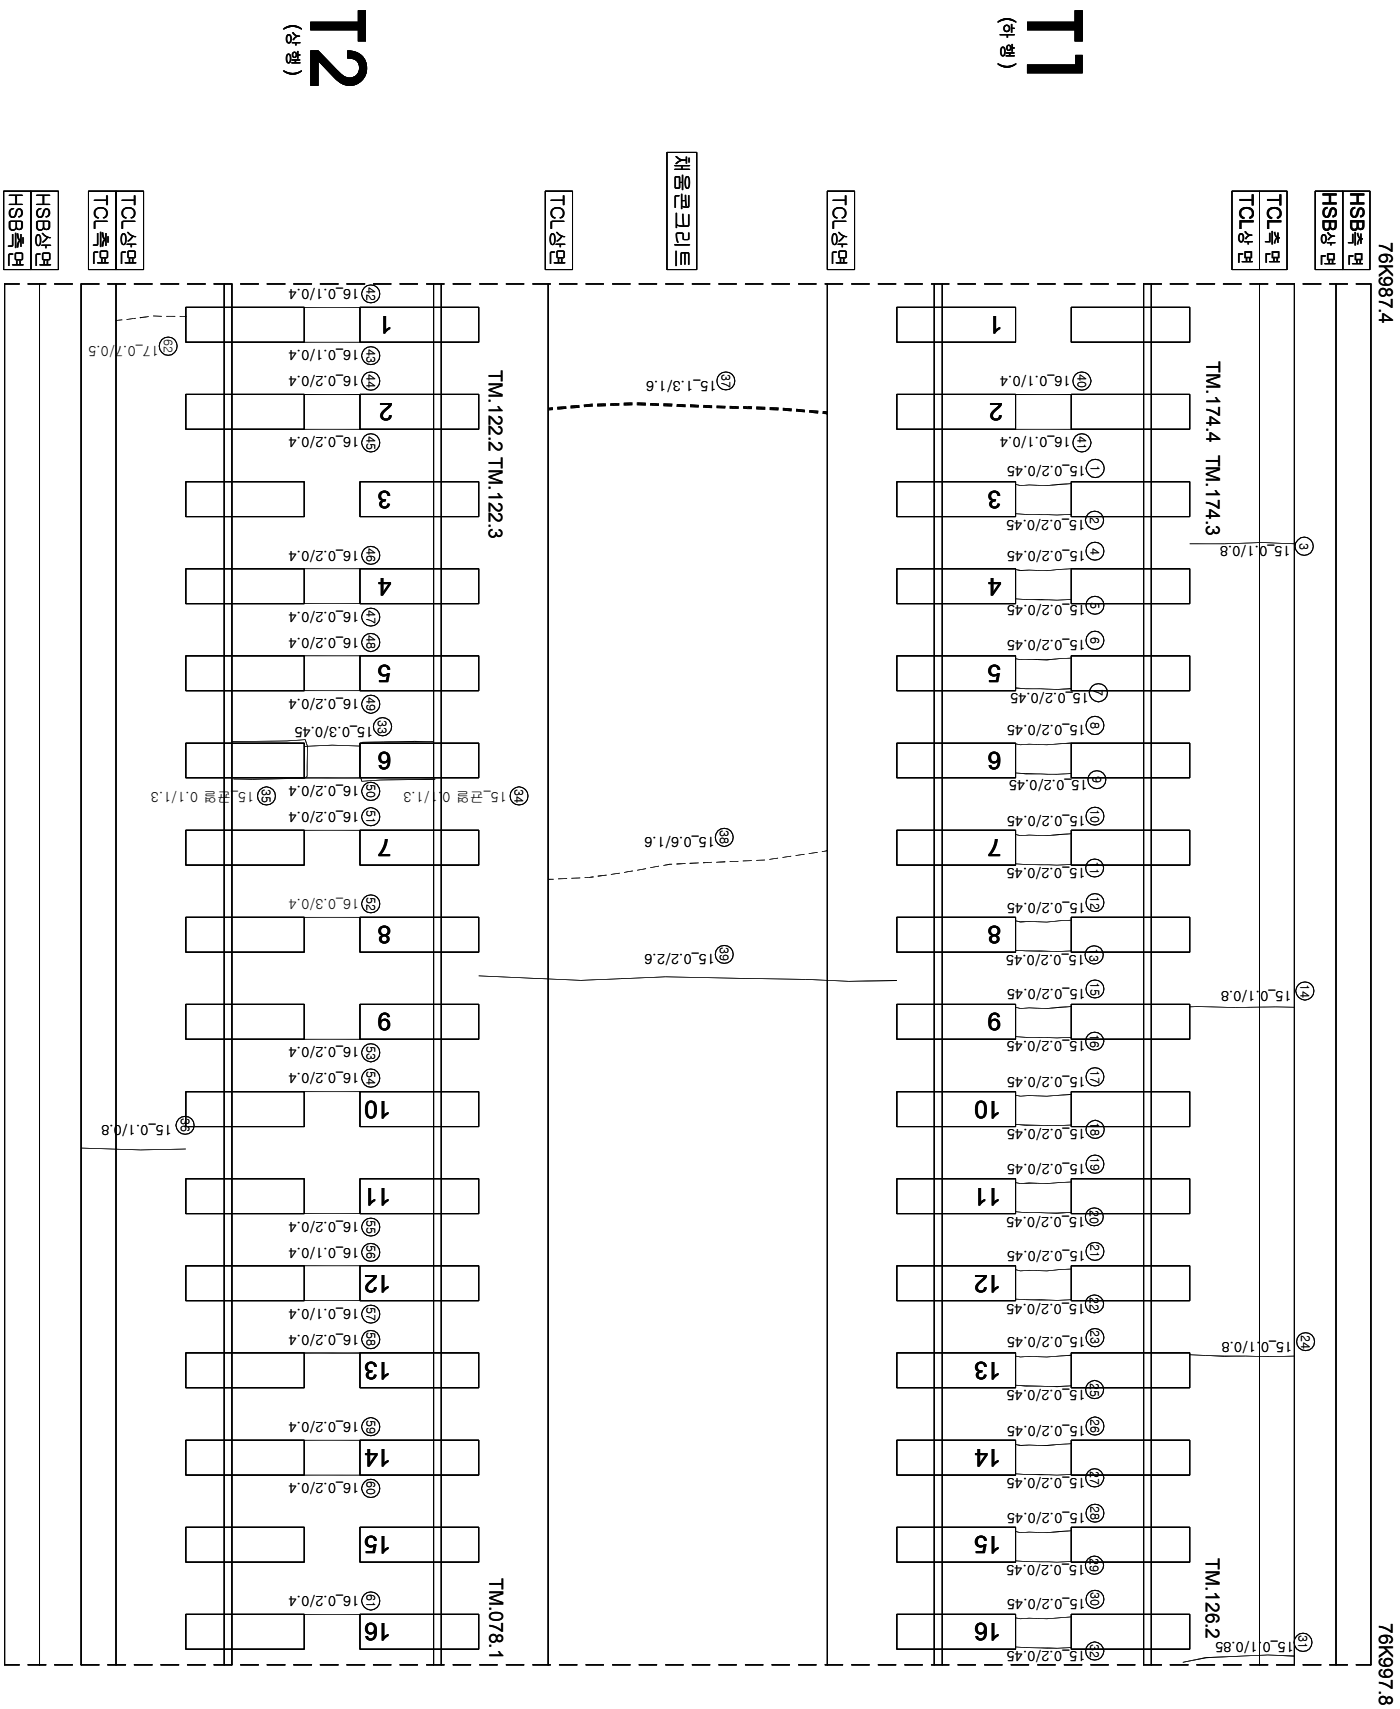

연번	손상	폭			연장	비고	연번	손상	폭			연장	비고
		0.2	mm	0.45					m	0.2	mm		
1	균열	0.2	mm	0.45	m		51	균열	0.2	mm	0.4	m	
2	균열	0.2	mm	0.45	m		52	균열	0.3	mm	0.4	m	복층기
3	균열	0.1	mm	0.8	m		53	균열	0.2	mm	0.4	m	
4	균열	0.2	mm	0.45	m		54	균열	0.2	mm	0.4	m	
5	균열	0.2	mm	0.45	m		55	균열	0.2	mm	0.4	m	
6	균열	0.2	mm	0.45	m		56	균열	0.1	mm	0.4	m	
7	균열	0.2	mm	0.45	m		57	균열	0.1	mm	0.4	m	
8	균열	0.2	mm	0.45	m		58	균열	0.2	mm	0.4	m	
9	균열	0.2	mm	0.45	m		59	균열	0.2	mm	0.4	m	
10	균열	0.2	mm	0.45	m		60	균열	0.2	mm	0.4	m	
11	균열	0.2	mm	0.45	m		61	균열	0.2	mm	0.4	m	
12	균열	0.2	mm	0.8	m		62	균열	0.7	mm	0.5	m	신구
13	균열	0.2	mm	1.8	m		63						
14	균열	0.1	mm	0.8	m		64						
15	균열	0.2	mm	0.45	m		65						
16	균열	0.2	mm	0.45	m		66						
17	균열	0.2	mm	0.45	m		67						
18	균열	0.2	mm	0.45	m		68						
19	균열	0.2	mm	0.45	m		69						
20	균열	0.2	mm	0.45	m		70						
21	균열	0.2	mm	0.45	m		71						
22	균열	0.2	mm	0.45	m		72						
23	균열	0.2	mm	0.45	m		73						
24	균열	0.1	mm	0.8	m		74						
25	균열	0.2	mm	0.45	m		75						
26	균열	0.2	mm	0.45	m		76						
27	균열	0.2	mm	0.45	m		77						
28	균열	0.2	mm	0.45	m		78						
29	균열	0.2	mm	0.45	m		79						
30	균열	0.2	mm	0.45	m		80						
31	균열	0.1	mm	0.85	m		81						
32	균열	0.2	mm	0.45	m		82						
33	균열	0.3	mm	0.45	m		83						
34	균열	0.1	mm	1.3	m		84						
35	균열	0.1	mm	1.3	m		85						
36	균열	0.1	mm	0.8	m		86						
37	균열	0.3	mm	1.6	m		87						
38	균열	0.6	mm	1.6	m		88						
39	균열	0.2	mm	2.6	m		89						
40	균열	0.1	mm	0.4	m		90						
41	균열	0.1	mm	0.4	m		91						
42	균열	0.1	mm	0.4	m		92						
43	균열	0.1	mm	0.4	m		93						
44	균열	0.2	mm	0.4	m		94						
45	균열	0.2	mm	0.4	m		95						
46	균열	0.2	mm	0.4	m		96						
47	균열	0.2	mm	0.4	m		97						
48	균열	0.2	mm	0.4	m		98						
49	균열	0.2	mm	0.4	m		99						
50	균열	0.2	mm	0.4	m		100						

[illegible]